GOVERNMENT OF PUERTO RICO / OFFICE OF THE GOVERNMENTAL PROTECTION AGENCY RO II



96 NOV 22 PH 4: 19 DECA-WATER COMPLI. BR.

October 22, 1996

Ms Kathleen C. Callahan
Director
Division of Environmental Planning
and Protection
Environmental Protection Agency
290 Broadway
New York, NY 10007-1866

Dear Ms. Callahan:

Enclosed is the Final Report for the proteject <u>IDENTIFICATION OF ILLEGAL SANITARY</u> <u>WATER DISCHARGES IN THE MARTIN PEÑA CANAL</u> that is was developed through Section 104(b)3 funds. This report includes the findings of the water quality samplings performed to quantify the impact in the water quality of Martín Peña Canal, of the illegal sanitary connections to the Figueroa storm water pump station. It does not include the laboratory data for metals analyses due to problems related to the quality control and assurance requirements. As soon as these results are received, we will prepare an "addendum" to this report.

If you have any questions, please contac Mr Robert Ayala at (787) 751-5548.

Cordially,

Director/

Water Quality Area

Enclosure

cc: Mr Julio Vázquez EPA, Region II

> NATIONAL PLAZA BUILDING/431 PONCE DE LEON AVE./HATO REY, P.R. 00917 P.O. BOX 11488/SANTURCE, P.R. 00910/TELEPHONE (809) 767-8181

GOVERNMENT OF PUERTO RICO / OFFICE OF THE GOVERNOR



Final Report "Identification of Illegal Sanitary Connections to Storm Water Discharges in the Martín Peña Canal"

The "Martín Peña Canal" is a natural canal that connects the San Juan Bay with the San José Lagoon and is part of the San Juan Bay Estuarine System (SJBES), which was declared an estuary of national importance by the Environmental Protection Agency (EPA). This waterbody is classified by the Water Quality Standards Regulation (WQSR) as SC. These are coastal waters designated for recreational activities such as fishing and boating and for the preservation and propagation of desirable species. The Martín Peña Canal presents a high degree of contamination due to discharges of sanitary waters, garbage and rubble which restains compliance of the uses established in the WQSR for this waterbody.

Since 1986, the Puerto Rico Environmental Quality Board (PREQB) iniciated studies to identify the source of contamination of the SJBES, including the development of an inventory of wastewater disposal methods of the structures bordering these waterbodies. Currently, this inventory includes the wastewater disposal methods of a total of 24,197 structures distributed in 33 sectors near the SJBES.

The findings showed that the system, specifically the Martín Peña Canal receives wastewater discharges from interconnections between waste and storm water systems, from illegal discharges to the storm water systems and from direct discharges to the waterbodies.

NATIONAL PLAZA BUILDING/431 PONCE DE LEON AVE./HATO REY, P.R. 00917 P.O. BOX 11488/SANTURCE, P.R. 00910/TELEPHONE (809) 767-8181 Another source of contamination identified are the storm water pump stations that receive sanitary waters. Although these pump stations were constructed for flood control purposes, there are several of them that need to be activated daily even during dry seasons. The most significant case is the storm water pump station located at the Figueroa neighborhood (stop 18)in Santurce. This pump station, owned by the Department of Natural and Environmental Resourses (DNER), receives a great amount of sanitary waters from an area in Santurce. These sanitary waters discharge to the Martín Peña Canal in the area used by the "Aquaexpreso" transportation system. The data obtained from the DNER for November 1991 to April 1992 showed that this station discharged a total of 441,125,000 gallons of untreated waters to Martín Peña Canal during that period. Most of these discharges were made during dry seasons.

In Fiscal Year 1992, EQB received \$45,000 in federal funds under Section 104 (b) 3 of the Clean Water Act, to identify the source of the sanitary water that reaches this storm water pump station. The findings and results of this study are found in the Progress Report of the Project for the Identification of Illegal Sanitary Connections to Storm Water Discharges in the Martín Peña Canal that was sent to the EPFA on February 17, 1994 (Appendix 1).

The project developed included a water quality sampling to quantify the impact of the pump station discharge in the water quality of Martín Peña Canal. The samples taken were analyzed to identify bacteriological contamination, nutrients and nine (9) metals. Appendix 2 contains a list of the parameters analyzed, according to the Quality Assurance Project Plan (QAPP) revised on March 1994. However, due to several problems related to monitoring procedures and results, three (3) monitoring incursions were necessary. The problems arose and the findings at each monitoring incursion are as follows:

1. August 29, 1994

Samples were taken at three (3) monitoring stations:

<u>Station</u> <u>Description</u>

- 01 At the discharge of the Figueroa pump station.
- 02 At Martín Peña Canal, east of the pump station discharge.
- 03 At Martín Peña Canal, west of the pump station discharge.

The bacteriological samples were analyzed at the PREQB laboratory. The nutrients and metals samples were sent to the United States Geological Survey (USGS) laboratory in Ocala, Florida. Appendix 3 includes the sampling results except data for metals analyses, due to problems related to the quality control and assurance requirements. As soon as these results are received, we will prepare an "addendum" to this report.

The TP, ammonia nitrogen and TKN values were higher at station 01 (pump station discharge). However, NO3 + NO2 nitrogen was higher at station 03 (Martín Peña Canal, west of the pump station discharge). The WQSR does not include standards for neither of these parameters for SC waters. Concerning the bacteriological analyses, the evaluation of the data showed a discrepancy between the results of the analyses and the location of the monitoring stations. Station 03, located downstream of the pump station discharge according to the tide movement, registered fecal coliform values of <1 colonies per 100 milliliters (col/100ml), less than station 02 located upstream of the pump station discharge (see Appendix 3). Furthermore, we found that important information concerning the procedure and conditions of the sampling were omitted. Among these are:

a. The sampling report did not include the climatological conditions (such as rain, sun, wind, among other factors).

- b. The QAPP was designed taking into consideration tidal fluctuations. There was no indication of the tidal condition during sampling.
- c. The location and description of the monitoring stations did not agreed with the approved QAPP. No reason was submitted for this variation.
- d. The report did not indicate if the pump station was activated before the sampling.

For all of these reasons, a new sampling was required for bacteriological analyses (fecal coliform, fecal streptococci and total coliforms).

2. March 15, 1995

A new sampling at the pump station and Martín Peña Canal was performed. The samples were taken during the hours in which the tide was at its lowest point, according to the data given by the Meteorological Station in San Juan. Samples were taken during and after the discharge of 75,000 gallons of wastewater to the Martín Peña Canal from the storm water pump station located at the Figueroa sector in Santurce. To correct the previous monitoring deficiencies, samples were taken at five (5) monitoring stations located at the pump station and the receiving waterbody. The description of these stations is as follows:

Station	<u>Description</u>
01	At the pump station discharge
02	At Martín Peña Canal, at the De Diego Expressway bridge.
03	At Martín Peña Canal, 600 ft. east of the canal that receives the discharge from the pump station.

O4 At Martín Peña Canal, at the joint with the canal that receives the discharge

from the pump station.

05 At Martín Peña Canal, 600 ft. west of the canal that receives the discharge from

the pump station.

Appendix 4 includes the results of this sampling. The data showed fecal coliform values that ranged from 6,650 col/100ml (Station 02) to 87.650 col/100ml (Station 05), all of them in violation to the WQSR. An additional sampling was programmed for bacteriological analyses.

 
3. March 27, 1995

As in the previous occasion, the samplings for bacteriological analyses were performed when the tide was at its lowest point, according to the data given by the Meteorological Station in San Juan. The sampling conditions were favorable and samples were taken after activation of the Figueroa pump station. Eventhough the tide was at its lowest point, the effects of the strong breeze over the water surface were noticed.

The results of this sampling can be found in Appendix 5. Fecal and total coliforms values were found as too numerous to count (TNTC) in the dilutions of 0.1, 1.0 and 10 mg/l. Eventhough PREQB does not have a standard for fecal streptococci, the registered values ranged between 17,650 col/100 ml at Station 03 (Martin Peña Canal, 600 ft. east from discharge) to 867,000 col/100 ml at Station 01 (pump station discharge). These results confirmed the fecal contamination problem that we presumed exists in the Martín Peña Canal.

MR/yhs

Doc: 96-005



COMMONWEALTH OF PUERTO RICO/OFFICE OF THE GOVERNOR ENVIRONMENTAL QUALITY BOARD



Water Quality Area

February 18, 1994

Mr. Richard Caspe Chief Caribbean Municipal Programs Branch Region II, 26 Federal Plaza New York, N.Y.,10276

Dear Mr. Caspe:

Enclosed is the latest Progress Report for the project IDENTIFICATION of ILLEGAL SANITARY CONNECTIONS to STORM WATER DISCHARGES in the MARTIN PEÑA CANAL that is being developed through Section 104(b)3 funds. This report includes the more recent findings detected during the field investigations performed by our technical personnel.

Currently, we are taking additional steps in order to require PRASA the clean up of the obstructed sewer lines in order to finish our investigations at the study area.

Cordially,

Lucinia Chigling Director

Water Quality Area

Enclosure

cc: Mr. Julio Vázquez

EPA, Region II

DOC. NAME: CRICASPE

1994-00-23

MR/mr

OFFICE OF THE BOARD: NATIONAL PLAZA BUILDING/431 PONCE DE LEON AVE. P.O. BOX 11488/HATO REY, PUERTO RICO 00910/TELEPHONE: 767-8181

COMMONWEALTH OF PUERTO RICO / OFFICE OF THE GOVERNOR



1 3000

FEB 17 1994

PROGRESS REPORT OF THE PROJECT
FOR THE IDENTIFICATION OF ILLEGAL
SANITARY CONNECTIONS TO STORM
WATER DISCHARGES IN THE
MARTIN PEÑA CANAL

The investigation already performed by the Waterbodies Restoration Division of EQB'S Water Quality Area shows there are several situations, almost all related with deficiencies in the sanitary systems of the Puerto Rico Aqueduct and Sewer Authority (PRASA), that are responsible for the wastewater discharges to the Stop 18 storm sewer pumping station and to the Martín Peña Canal. These deficiences and the interconnections of wastewaters to the storm sewer system are contributing with more than half of the sanitary waters that are reaching this pumping station and are being discharged to the Martín Peña Canal. These situations are illustrated on Map #1 and are described as follows:

1. There is a sanitary line that begins near the Central High School for Fine Arts (Ponce De León Avenue near Stop 20) in Santurce. However, this sanitary line is really functioning as a combined sewer, due to the fact that it receives the sanitary and storm waters discharges from many of the structures located along Ponce De León Avenue in Santurce.

This system goes from south (Hato Rey) to north (San Juan) and is located at the east sidewalk of the Ponce De León Avenue. Almost all the structures at the east side of this Avenue and one 10 stories building (Ponce De León #1250) located at the west side of the Ponce De León Avenue discharge their sanitary waters to this combined system. Also, there are ten (10) streets at the east side of the Ponce de León Avenue that partially discharge their wastewaters to this combined system.

The combined sewer system continues through the Ponce De León Avenue up to Tizol Street, where it receives the combined (sanitary and storm) waters from the north side of the Ponce De León Avenue (See #1 in Map #1). This system crosses under the Ponce De León Avenue, continues below "Nuestro Teatro", up to Condado and Del Carmen

Streets. At this point, the flow divides and about 75% of it reaches a storm sewer main trunk, going to the Stop 18 pumping station. The remaining 25% goes to the sanitary line at the Condado and Del Carmen Streets.

- 2. The sewer system at Del Carmen Street and Condado Corner is obstructed and the sanitary waters backflow to the storm sewer described under item 1 above. This illegal discharge to the storm sewer system was confirmed by dye test.
- 3. Interconnection from the sanitary sewer system to the storm sewer system at Hipódromo Street corner with Fernández Juncos Avenue. This interconnection receives the sanitary waters from an area comprised by: north- Ponce de León Avenue; south-Fernández Juncos Avenue; east- De Diego Expressway (Tunel Minillas); and west- Hipódromo Street. The storm sewer system goes through the Instituto de Ciegos (School for Blinds) Loaíza Cordero and reaches the Stop 18 pump station.
- 4. The area from the Fernández Juncos Avenue up to Feria Street does not have a sanitary sewer system and is discharging to a storm sewer at Hipódromo Street corner with Feria Street. The area lacking sanitary sewers includes eight (8) structures, among them an eight (8) stories building.
- 5. Restrooms of the Instituto de Ciegos (School for Blinds) Loaiza Cordero is discharging to the storm sewer.
- 6. Interconnection of the sanitary sewer to a storm sewer at Del Carmen Street corner with Figueroa Street.
- 7. Interconnection from the sanitary sewer to the storm sewer at San Juan Street corner with Navas Street. This situation was confirmed by dye tests.
- 8. Sanitary waters from Ernesto Cerra Street discharging to the storm sewer system at Fernandez Juncos Avenue. The origin of these sanitary waters has not been investigated due to the obstruction of the storm sewer of the Ernesto Cerra Street. The clean-up of the storm sewer system was requested to the Municipality of San Juan without any action being taken up to now.
- 9. Storm sewer at sidewalk in the Fernández Juncos Avenue, between Monserrate and San Juan Streets receiving sanitary waters. This storm sewer line joins a storm sewer main trunk at Fernández Juncos Avenue, in front of San Juan Street, up to the Stop 18 Pump Station. There are several structures in this area that are pending to be investigated.


海峡


- 10. Sanitary waters from two (2' structures at Ponce de León Avenue, between Figueroa and Hipódromo Streets, discharging to the storm sewer system at Figueroa Street. These structures are: Ponce de León #1309 and Ponce de León #1302. Both structures are three (3) stories buildings.
- 11. Interconnection of sanitary waters to a storm sewer at Fernández Juncos Avenue near San Juan Street. This storm sewer goes through the Ruiz Belvis School yard and through the Café Yaucono industry before joining the storm sewer system at Del Carmen Street. Map #2 shows the area discharging to this storm sewer through this interconnection.
- 12. Interconnection of the sanitary system at Feria Street to the storm sewer system (near School for Blinds). This sanitary sewer receives the sanitary waters from the Doctor's Hospital and from a clinic and environmental laboratories.

Each of the above situations are shown in Map #1. The situations described in #1,3,11 and 12 are the ones with the greatest amount of sanitary waters to the Stop 18 Pump Station. However, Map #3 shows several areas within the study area that are pending to determine the disposal and/or origin of the sanitary waters to storm sewers. The obstruction of the sanitary and storm sewer systems is the principal obstacle to such determination. The clean up of these storm and sanitary sewers have been requested in several ocassions to PRASA and to the Municipality of San Juan in order to finish our investigations (See appendix I). This clean-up has not yet been done.

DOC. NAME: PROREP18

1994-00-14 MR/nrb

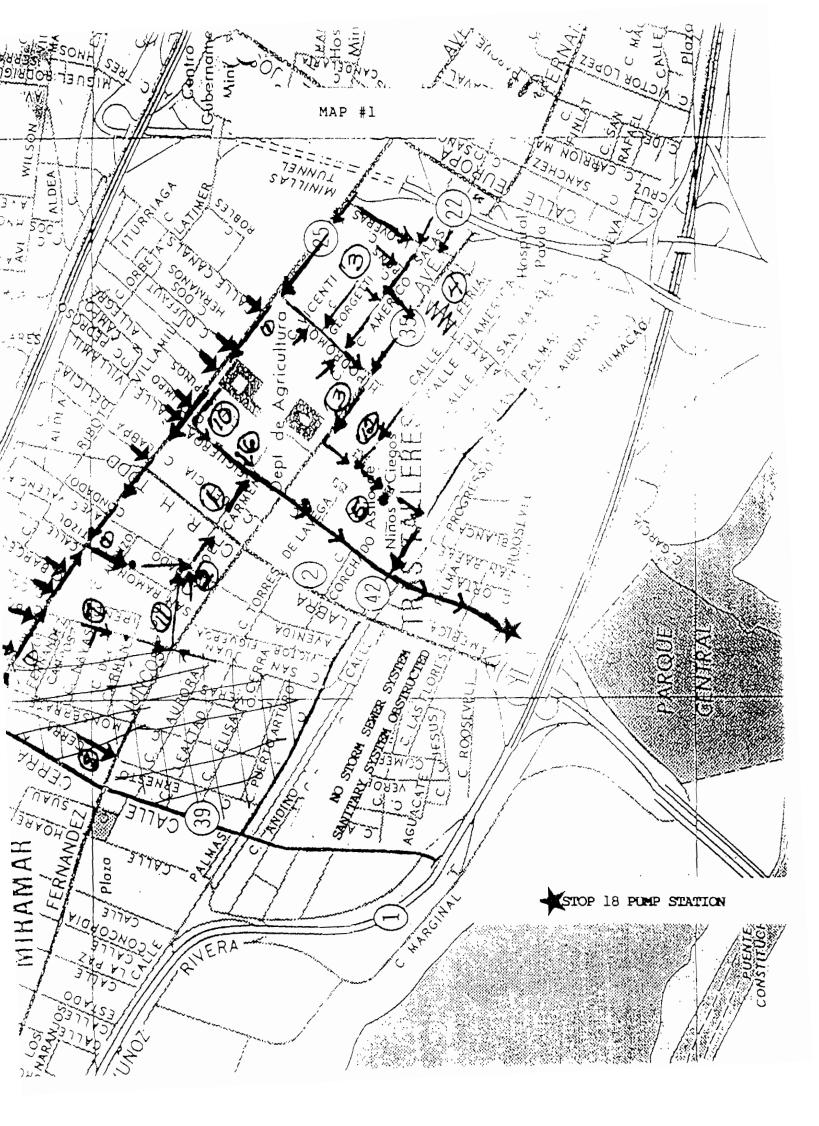

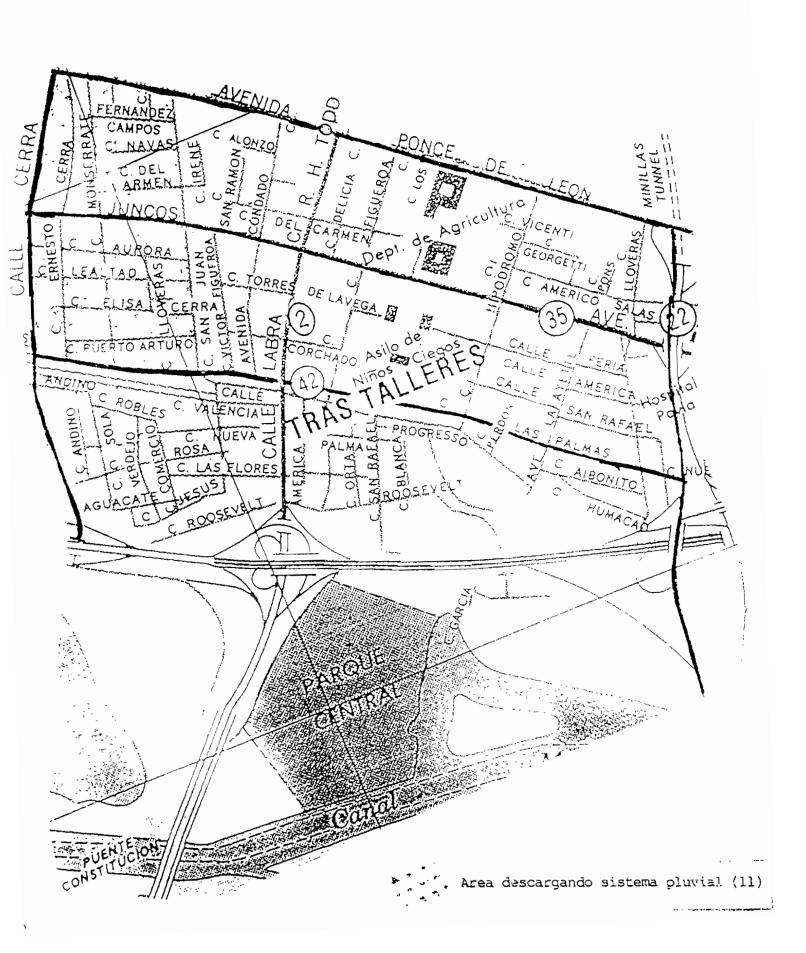




 


TABLE II

PARAMETER QAPP-1

	MINORED OF	CAMPA	ANALYTICAL	23.V		
PARAMETER	NUMBER OF SAMPLES	SAMPLE MATRIX	METHOD REFERENCE	SAMPLE PRESERVATION	HOLDING TIME	
NO ₂ + NO ₃ as N	3	Water	USGS-I-4545-85	HgCl,/NaCl Cool 4°C	28 days	
NH ₃ - N	1)	"	USGS-I-4522-85		11	
Total Phosphorous	11	H	USGS-I-4600-85	n	"	
Chlorides	H	"	USGS-I-2057-84	Cool 4°C	n	
Oil & Grease	h	tr	EPA 413.1	H ₂ SO ₄ pH <2	"	
Total Dissolved Solids (TDS)	11	Ħ	USGS-I-3750-84	Cool 4°C	7 days	
Total Suspended Solids (TSS)	tt	"	USGS~I-3765~84	п	72	
Fecal Coliforms	Ħ	11	Std. Methods 17 th 9222 D	п	6 hours	
Total Coliforms	Ft	"	Std. Methods 17 th 9222 B	11	"	
Hydrogen ion (ph)	11	"	EQB SOP 021.2	n/a	Analyzed in field	
Dissolved Oxygen	tt	"	EQB SOP 021.3	н -	H	
Temperature	"	"	EQB SOP 021.1	н	11	
Arsenic (As)	II .	tī .	USGS I-3062-85	HNO ₃ pH <2 Cool 4°C	6 months	
Barium (Ba)	11	Ħ	EPA 208.2	11	H	
Cadmium (Cd)	H	11	USGS I-3138-89	11	lt .	
Copper (Cu)	n	11	USGS I-1274-89	11	н	
Total Chromium	n	"	EPA-200.7	11	п	
Manganese (Mn)	**	H	EPA-200.7	"	lt .	
Mercury (Hg)	11	11	USGS I-3462-85	HNO ₃ /KCr ₂ O ₄ Cool 4°C	28 days	
Lead (Pb)	π	Tt .	USGS I-3403-89	HNO ₃ pH<2 Cool 4°C	6 months	
Zinc (Zn)	*	11	EPA 200.7	11	11	

 



ENVIRONMENTAL QUALITY BOARD OFFICE OF LABORATORIES MICROBIOLOGY WATER QUALITY STUDIES

Study Cano Martin Rina
Body of Water Educus que salade Date 30/agento/44

Page /_ of /__

Analyst Signature Super Clifford Supervisor Signature Super a Unity of the Supervisor Signature Supervisor Signature Supervisor Signature Supervisor Signature Supervisor Supervisor Signature Supervisor Supervi

STA. No.	TOTAL COLIFORMS COUNTS/100ML	FECAL COLIFORMS COUNTS/100ML	FECAL STREPTOCOCCUS COUNTS/100ML	METHOD	DATE	OBSERVATIONS
CI	0	O		MF	29/ajusto/54	ruscon delectoriste 35,109 Intranct
Ext 01	> 8,000	25,600		MF	29 Jayosty sy	hada arm id ii b alkini d E
Ext 00	X=78,000	¥=1,600		MF	29/ajo.to/94	Tente en dellectrenche 51,109 impara et 19 en 35 910 net para Escado
Est 03	7.8,000	21		MF	29/4 10/94	TWICE en delicusion ale DT, 10/9/ met pour aveilures de le Dufuren totales
CF	O	0		MF	29/agooh/54	
						PSOCIADO O
	·				<u> </u>	St. Car
						Edwin Marlinez
						LIC. #2336
						and the second
						DA A DO

APROBADO

PUERTO RICO ENVIRONMENTAL QUALITY BOARD WATER QUALITY AREA

Project Name: <u>Identification of Illegal Sanitary Connections to Stormwater</u>
<u>Discharges in the Martin Peña Canal</u>


QAPP Number: 1

Sampling Date: August 1994

Station No.	NO ₂ + NO ₃ - N mg/l	TKN mg/l	(四月化) TP mg/l	NH ₃ N mg/l	Chlorides mg/l	Oil & Grease mg/l	TDS*	TSS*	AS µg/l	Ba µg/l	Cd µg/l	Cu µg/l	Crt µg/l	Mn µg/l	Hg µg/l	Pb µg/l	Zn µg/l
MPC - 001	<0.02	25.0	2.8	17.0													
MPC - 002	0.49	1.6	0.25	0.92													
MPC - 003-a	1.1	0.56	0.15														

*TDS - Total Dissolved Solids

 *TSS - Total Suspended Solids





istribution Orig.

ENVIRONMENTAL QUALITY BOARD SAMPLING DIVISION

AVE. PONCE DE LEON #431

HATO REY, P.R. 00917 CHAIN OF CUSTODY RECORD 106 Bemba Parendo 18 Piña SURVEY SAMPLER (Signature) Container
p Volume & Station Samp Type Analysis Number Station Location Date Time Water temp seg Preserva Regulered Specific comp | grab O. no. Descara de la bombe 950310 27.0 1136 CF-CT EF 001 500 m Cool A Tuente ex preso de Diego 500 m/ CF-CT FF 002 960315 1136 26.0 Inte de la zenión al Care 9503 10 1/500 ml CF-CT EF 28.0 3 1209 M. Peña * * despues de la 1300 CF-CT EF 950515 29.0 renion Caño M. Piña 1500 ml CF-CT FF 29.0 600 despus de la renjon 950315 1357 005 Caño MPeña lado Izrvierd mirando hercia Received by (signature) Date Time Date Time Temperature ispached by: / Signature 0.5 °C 15/marzo 85 15/mars 95 1456 1456 wason forales 'emarks CF = coliforne tecales CT = Coliforne tolates EF = estrepto cocos

Copy Survey Coordination Field F



ENVIRONMENTAL QUALITY BOARD OFFICE OF LABORATORIES MICROBIOLOGY WATER QUALITY STUDIES

Study Caño Martin Peña


Body of Water Estuatio

Date_03-17-95

Page of ___

Analyst Signature Of Chile Secretary Supervisor Signature

CI 0 0 MF 03-15-95 Est.1 21 760,000 760,000 MF 03-15-95 por analysis CF u.	
Est. 1 41 Three moduciones	
21 760,000 760,000 MF 03-15-95 para analisis CF 4.	C F-
Est. 2	10 Mf. Para analisis
Est. 4 21 760,000 760,000 MF 03-15-95 Para analysis CF 45	10, 10 y 6-1 41.
Est. 5 21 87, 450 44,500 MF 13-15-05 prolists CF 4 SF.	io Wi-pora
CF 0 0 MF 03-N5-95	
and the state of t	ASOCIADO OF
	(CW) IE
	Win Martinez 3
	IC. #2336 3

 



ENVIRONMENTAL QUALITY BOARD SAMPLING DIVISION

AVE. PONCE DE LEON #431 HATO REY, P.R. 00917

106 Bomba Parada 18 I Cara Martin Pana **SURVEY** SAMPLER (Signature) K hquelog station Samp Type Container √umber Station Location Date Time Analysis Water P temp seg Volume & Preservation Reguiered comp | grab no. Specific 950327 1057 Dasc. de la bomba 001 28.5 CF-CT-EF 4°C 500 m C.001 Prente expreso de Diepo 950327 1100 29.0 500 m 4°C CF-CT-EF Antes de la renion allano 950327 1132 29.0 1500 ml 400 3 CF-CT-EF • • m. Pino 600' des pues de la runion 950327 003 1248 500 ml 4°C CF-CT-EF 27.0 ,, Cano M. Pena lado derecho bahia hocia 600 despues de la zunion 950327 1248 005 1500 ml CF-CT-EF " 4°C 27.0 రౌ C. Martin Fina lado Ezy. מט קשעונא Date Time Received by (signature) spached by: Signature Date Time Temperature 27/03/95 1428 10 C 27/03/45 1425 CF = coliforme facules, CT = coliforme totale EF= estrepto cocas facule stribution Orig

Copy Survey Coordination Field Files

ENVIRONMENTAL QUALITY BOARD OFFICE OF LABORATORIES MICROBIOLOGY WATER QUALITY STUDIES

Study Cano Martin Pena

Body of Water Caro

Date 29 de marzo de 1995

1. . .

Page of ___

Analyst Signature Le Cheeda Sorel Supervisor Signature Biles Chillop)
Supervisor Signature Biller Chillop	ŲΪ

STA. No.	TOTAL COLIFORMS COUNTS/100ML	FECAL COLIFORMS COUNTS/100ML	FECAL STREPTOCOCCUS COUNTS/100ML	METHOD	DATE	OBSERVATIONS
CI	O	0	0	MF	27 marzo 95	
Est 1	TNTC > 80,000	TNTC > 60,000	867,000	MF	27 marzo 95	Total an delice the 12.17.17 pera and lists de CF3 CF y de 10 y 1 ml para EF.
Estz	TUTC > 80,000	TUTC > 60,000	20,850	44-	27	CHICTUCE YEL 10 MI POLL EF
Est 3	TUTC > 80,000	TNTC>60,000	17,650	MF	Z7 marzo 95	TWICE in delucious de 10, 19. Imparamá- lien de CT JCF y en 10 M para EF
Est 4	TNTC > 80,000	TNTC >60,000	533,000	AAC	27 0000095	dicty cf n er 10 2 / n para EF.
Est 5	7=TNTC>80,000	Z=TNTC>60,000	x= 48,175	MF.	27 marz095	The CIT CF 20 No M para CF New tell
CF	0	0	0	MF	Z7marzo95	
						ADRUB COCIO
						SEE STATE OF SEE
						6 Fowin Martinez
						S LIC. #2336 =
					·	Paling SS